

**BRITISH STANDARD**

---

**BS ISO  
14616 : 1997**

**Plastics —  
Heatshrinkable films of  
polyethylene, ethylene  
copolymers and their  
mixtures —  
Determination of the shrinkage  
stress and contraction stress**

ICS 83.140.10

**NO COPYING WITHOUT BSI PERMISSION EXCEPT AS PERMITTED BY COPYRIGHT LAW**



\*S\*

## National foreword

This British Standard reproduces verbatim ISO 14616 : 1997 and implements it as the UK national standard.

The UK participation in its preparation was entrusted to Technical Committee PRI/75, Plastics and rubber films and sheets, which has the responsibility to:

- aid enquirers to understand the text;
- present to the responsible international/European committee any enquiries on the interpretation, or proposals for change, and keep the UK interests informed;
- monitor related international and European developments and promulgate them in the UK.

A list of organizations represented on this committee can be obtained on request to its secretary.

### Cross-references

The British Standards which implement international or European publications referred to in this document may be found in the BSI Standards Catalogue under the section entitled 'International Standards Correspondence Index', or by using the 'Find' facility of the BSI Standards Electronic Catalogue.

**Compliance with a British Standard does not of itself confer immunity from legal obligations.**

### Summary of pages

This document comprises a front cover, an inside front cover, the ISO title page, page ii, pages 1 to 7 and a back cover.

This British Standard, having been prepared under the direction of the Sector Board for Materials and Chemicals, was published under the authority of the Standards Board and comes into effect on 15 September 1997

© BSI 1997

ISBN 0 580 28528 6

### Amendments issued since publication

Amd. No.	Date	Text affected

INTERNATIONAL  
STANDARD

ISO  
14616

First edition  
1997-07-01

---

**Plastics — Heatshrinkable films of  
polyethylene, ethylene copolymers and  
their mixtures — Determination of  
shrinkage stress and contraction stress**

*Plastiques — Films thermorétractables en polyéthylène, en copolymères  
d'éthylène et leurs mélanges — Détermination des contraintes de réfraction  
et de contraction*



52 \*

www.parsethylene.com



Reference number  
ISO 14616:1997(E)

**BS ISO 14616 : 1997****Foreword**

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

International Standard ISO 14616 was prepared by Technical Committee ISO/TC 61, *Plastics*, Subcommittee SC 11, *Products*.

**Descriptors:** plastics, thermoplastic resins, ethylene, polyethylene, heat-shrinkable materials, films, tests, determination, shrinkage.

# Plastics — Heatshrinkable films of polyethylene, ethylene copolymers and their mixtures — Determination of shrinkage stress and contraction stress

## 1 Scope

The purpose of this standard is to describe a conventional method for measuring the shrinking and contracting forces of heatshrinkable films made from polyethylene, ethylene copolymers and their mixtures.

The method described in this standard can possibly be applied to other materials under proper operating conditions.

NOTE 1 This method also allows a shrinkage ratio to be assessed. However, the reference method for measuring the shrinkage ratio is ISO 11501, Plastics - Film and sheeting - Determination of dimensional change on heating.

## 2 Definitions

For the purposes of this standard, the following definitions apply:

**2.1 heatshrinkable film:** Film which is extruded and stretched (hot drawn) during manufacture and which remains in this state after cooling down.

NOTE 2 When this film is again brought up to the temperature at which the stress was induced and then fixed during its manufacture, this stress is liberated and the film shrinks back.

Depending on the treatment applied, the film can be

- either heatshrinkable both lengthwise and crosswise: this film is called "biaxially oriented",
- or mainly heatshrinkable lengthwise: this film is called "uniaxially oriented".

**2.2 shrinkage ratio:** Decrease in the length of the specimen when it is brought up to the shrinkage temperature, expressed as a percentage of the initial specimen length.

**2.3 shrinking force,  $F_R$ :** Force developed by the film when it reaches the temperature corresponding to that at which the stress was induced at the time of manufacture.

**BS ISO 14616 : 1997**

A high film shrinkage is linked to this small force.

This small force and this high shrinkage permit the film to gently shrink down on the load.

**2.4 contracting force,  $F_c$ :** Force developed by the film during its cooling process.

This force, much greater than the shrinkage force, ensures the fastening of the load.

**2.5 reference temperature,  $\theta_r$ :** Air temperature measured by the probe located 5 mm adjacent to the force measurement specimen 45 s after mounting in the heating hood. Under these conditions, it is considered that sufficient time is allowed for the thermocouple used for the measurement to reach the temperature.

### 3 Principle of the measurement

Specimens connected to a force meter or to a displacement transducer are rapidly brought up to the shrinkage temperature, then cooled in the open air to an ambient temperature of  $23^\circ\text{C} \pm 2^\circ\text{C}$ .

A device continuously records the reference temperature, the force and possibly the displacement. The recording of these measurements allows one to determine the optimal shrinking conditions.

### 4 Apparatus

**4.1 Heating hood,** vertically mobile, equipped with heating elements and with a regulating device capable of maintaining the air temperature at the specified temperature.

**4.2 T-shaped bracket** allowing the fixing of the specimen.

**4.3 Force meter,** allowing the measurement of the shrinkage and contraction forces within a force range of at least 20 N with an accuracy of  $\pm 2\%$ .

**4.4 Displacement transducer,** capable of measuring a displacement with an accuracy of  $\pm 1$  mm.

**4.5 Multichannel acquisition device,** allowing the continuous recording of the different variables: times, forces, displacement, ...

**4.6 Thermocouple probe,** having a diameter of 1,5 mm (max), capable of measuring the air temperature 5 mm off the force measurement specimen with an accuracy of  $\pm 2^\circ\text{C}$ .

The thermocouple tip shall be oriented towards the middle of the specimen.

This thermocouple is used for determining the reference temperature  $\theta_r$ .

Depending on the heating resistors and on the location of the apparatus (influence of the environment), the performance characteristics of each individual testing apparatus may differ slightly.

It is therefore necessary to determine the relationship between the temperature  $\theta_r$  (45 s after mounting the heating hood, see 2.5) and that displayed by the regulating device.

Plot the correlation curve between  $\theta_r$  and the settings of the hood temperature regulating device.

This operation shall be repeated at regular intervals in order to detect any possible drift.

NOTE 3 In general, this correlation curve is determined for a range of temperatures  $\theta_r$  between 100°C and 230°C.

4.7 Thickness gauge, capable of measuring to an accuracy of 1  $\mu\text{m}$ .

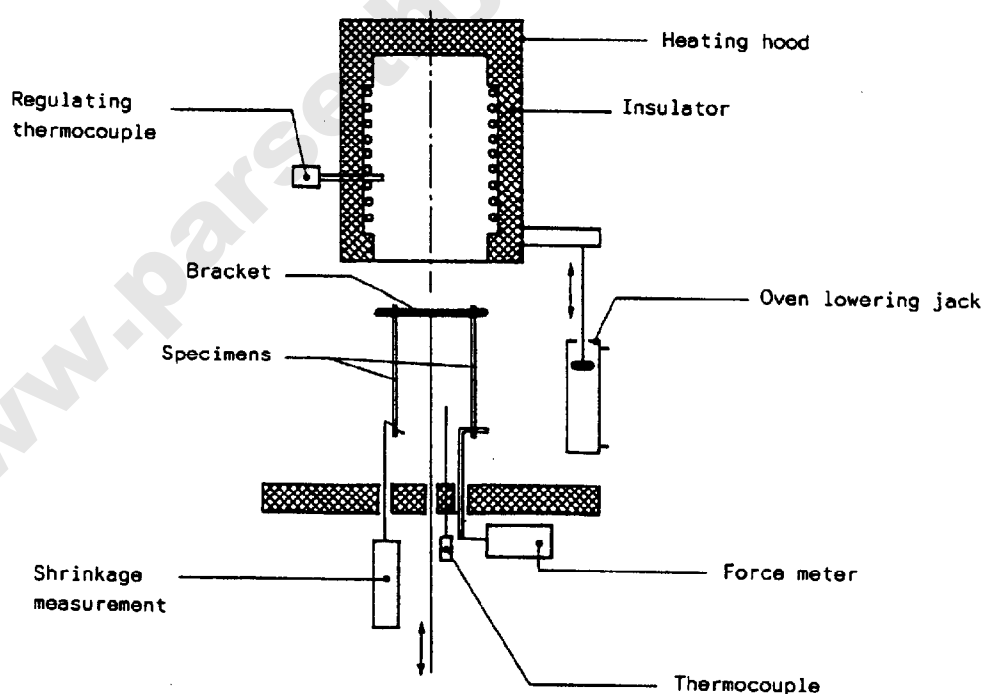


Figure 1 - Example of apparatus

**BS ISO 14616 : 1997****5 Specimens**

Prepare at least ten specimens in each direction (lengthwise and crosswise).

Their width shall be  $15 \text{ mm} \pm 0,5 \text{ mm}$ .

Their length shall be such that it is possible to have an effective length between jaws of 100 mm.

Their thickness, measured by the thickness gauge (4.7) to the nearest  $1 \mu\text{m}$ , is represented by the mean of three measurements repeated regularly on the specimen length.

**6 Procedure****6.1 Measurement of the shrinking and contracting forces**

The procedure is identical irrespective of the direction of the specimens, lengthwise or crosswise.

As the curves obtained with the lengthwise specimens are easier to develop, it is advised to begin testing in the lengthwise direction.

6.1.1 Install the specimens perfectly flat and straight on the force meter without applying any tensile force.

6.1.2 In the absence of a reference temperature  $\theta_r$ , known or specified by a product standard, set the temperature regulating device so as to obtain a reference temperature  $\theta_r$  of  $200^\circ\text{C} \pm 3^\circ\text{C}$  using the correlation curve defined in 4.6.

6.1.3 Lower the hood in order to bring the specimens to the shrinkage temperature.

Start the timer (or the recording of the time on the plotting table) and the recording of the force.

The film shrinkage temperature is reached when the maximum shrinking force is attained.

Record this force,  $F_r$ , in newtons.

When this force has decreased by around 15 % to 30 %, lift the hood and stop the timer (or the recording of the time). Record the time.

Continue to record the forces.

Record the maximum value of force attained by the contraction,  $F_c$ , in newtons.



6.1.4 If the maximum of the recorded shrinking force appears after less than 15 s exposure to the heat, repeat the test by lowering the reference temperature  $\theta_r$  by successive steps of 10°C until shrinkage is obtained between 15 s and 30 s.

If the maximum shrinking force does not appear after 30 s exposure to the heat, resume testing by raising the temperature by successive steps of 10°C until shrinkage is obtained between 15 s and 30 s.

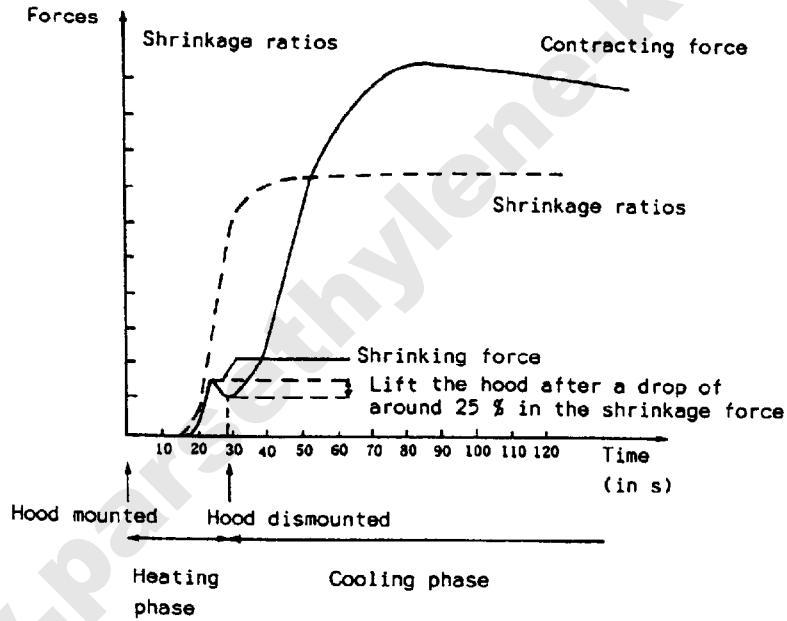


Figure 2 - Measurement of the forces and of the shrinkage ratio - Example of typical kinetics of the phenomena

**BS ISO 14616 : 1997****6.2 Assessment of the shrinkage ratio**

The assessment of the shrinkage ratio can be carried out either at the same time as that of the forces or consecutively, depending on the configuration of the apparatus.

It enables one to rapidly compare the properties of the shrinkable films in the production control procedure.

NOTE 4 This method does not replace the reference method for measuring the shrinkage ratio specified in ISO 11501.

6.2.1 Install the specimen perfectly flat and straight, between one of the arms of the bracket and the displacement transducer, the effective length of the specimen being 100 mm.

6.2.2 Conduct the measurement under the same conditions as those adopted for the measurement of the shrinking and contracting forces.

When they are conducted simultaneously, make additional provision for recording of the displacements.

Record the final value of the displacement after the cooling down of the specimen.

**7 Expression of results**

Calculate:

- the shrinking stress in pascals, Pa

$$\sigma_r = \frac{F_r}{S} \times 10^{-6}$$

- the contracting stress in pascals, Pa

$$\sigma_c = \frac{F_c}{S} \times 10^{-6}$$

- the shrinkage ratio, R, in percentage

$$R = \frac{L_o - L}{L_o} \times 100$$

where:

$F_r$  is the shrinking force, in newtons;

$F_c$  is the contracting force in newtons;

S is the area of the initial cross section of the specimen, in square millimetres;

$L_0$  is the initial length of the specimen, in millimetres;

L is the length of the specimen after heat shrinking, in millimetres.

## 8 Precision

Since the precision of this test method is not known because inter-laboratory data are not available, this method is only applicable for comparison purposes within a laboratory.

## 9 Test report

The test report shall refer to this standard and shall mention the following information:

- a) type and origin of the film being tested;
- b) thickness of the film;
- c) degree of orientation;
- d) reference temperature  $\theta_r$ ;
- e) value of the shrinking stress  $\sigma_r$ , in pascals, Pa, and value of contracting stress,  $\sigma_c$ ;
- f) shrinkage ratio, R, in percentage for information;
- g) mean and standard deviation;
- h) procedural details not provided for in the standard and incidents which may have influenced the results;
- i) date of test.

**BS ISO  
14616 : 1997**

---

## **BSI — British Standards Institution**

BSI is the independent national body responsible for preparing British Standards. It presents the UK view on standards in Europe and at the international level. It is incorporated by Royal Charter.

### **Contract requirements**

A British Standard does not purport to include all the necessary provisions of a contract. Users of British Standards are responsible for their correct application.

### **Revisions**

British Standards are updated by amendment or revision. Users of British Standards should make sure that they possess the latest amendments or editions.

It is the constant aim of BSI to improve the quality of our products and services. We would be grateful if anyone finding an inaccuracy or ambiguity while using this British Standard would inform the Secretary of the responsible technical committee, the identity of which can be found on the inside front cover. Tel: 0181 996 9000; Fax: 0181 996 7400.

BSI offers members an individual updating service called PLUS which ensures that subscribers automatically receive the latest editions of standards.

### **Buying standards**

Orders for all BSI, international and foreign standards publications should be addressed to Customer Services, Sales Department at Chiswick: Tel: 0181 996 7000; Fax: 0181 996 7001.

In response to orders for international standards, it is BSI policy to supply the BSI implementation of those that have been published as British Standards, unless otherwise requested.

### **Information on standards**

BSI provides a wide range of information on national, European and international standards through its Library, the Standardline Database, the BSI Information Technology Service (BITS) and its Technical Help to Exporters Service. Contact the Information Department at Chiswick: Tel: 0181 996 7111; Fax: 0181 996 7048.

Subscribing members of BSI are kept up to date with standards developments and receive substantial discounts on the purchase price of standards. For details of these and other benefits contact Customer Services, Membership at Chiswick: Tel: 0181 996 7002; Fax: 0181 996 7001.

### **Copyright**

Copyright subsists in all BSI publications. BSI also holds the copyright, in the UK, of the publications of the international standardization bodies. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols, and size, type or grade designations. If these details are to be used for any other purpose than implementation then the prior written permission of BSI must be obtained.

If permission is granted, the terms may include royalty payments or a licensing agreement. Details and advice can be obtained from the Copyright Manager, BSI, 389 Chiswick High Road, London W4 4AL.

BSI  
389 Chiswick High Road  
London  
W4 4AL